

Serial Port Multiplexer Version 1.03

Release Notes

Version 1.03 Release Notes

Bug Fixes

- Sometimes the MUX channel would not open upon connection to the multiplexer. The size of the receive buffer was increased to reduce the possibility of losing part of the commands.

- If the multiplexer got an interrupt (from the controller, YPM or ambient light on an unused channel) at the time the PC was calling in to the multiplexer, it was possible for the wrong channel to be opened, causing communication failure. This occurred because the multiplexer stopped responding to the PC communications once an interrupt was received and the wrong channel was left open from the previous interrupt. The multiplexer now continues to check communications from the PC even after an interrupt.